

Manhole Inspection Summary

Manhole # S11II_037MH

Printed On: 8/6/2009

Page 1 of 3

Inspection ☒ **Is Incomplete** Rating: **2) Good**

Record Plat: **11II** Node: **037** Status: **Found**

Insp Date: **6/23/09 1:08 PM**

Incomplete Comments

Can No Longer Open The MH To Achieve Better Pictures

Crew: **ads1**
Inspector: **ADS1**
Firm: **ADS**

Location Address: **3139 NORTH AVE**

Cross Street: **BLOOMINGDALE RD**

Manhole Type: **Terminal**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **CAN NOT OPEN LID STUCK**

Cover

Shape: **Circular**

Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
7

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☐ Exists Material:

☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **38** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps

Count: **11** Missing: **8** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View

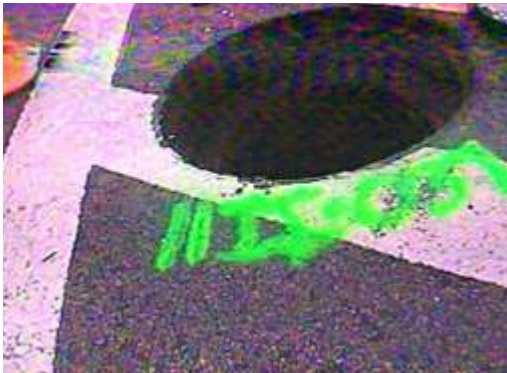


Top View



Top View

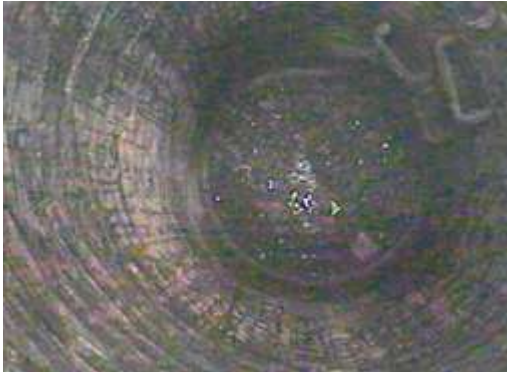

Defect 1

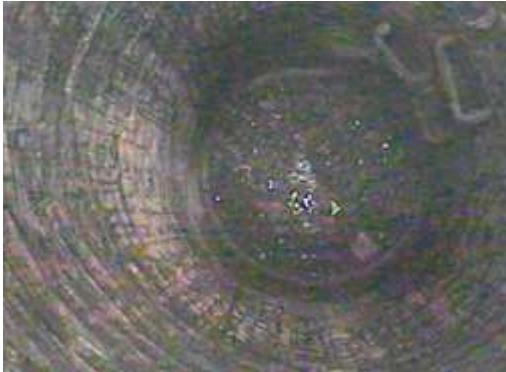

MISSING STEP

Manhole Inspection Summary

Manhole # S11II_037MH

Printed On: 8/6/2009

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.46** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1.5** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection